

# CMA kit parts inventory

This CMA kit is for the Toolless Slide Rail Kit.

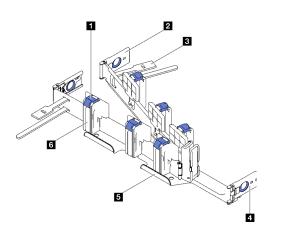


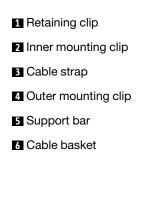


## Install the CMA

**Note:** The following illustrations might differ depending on the server, but the installation method is the same.

Step 1. Align the inner mounting clip with the inner tab on the slide; then, push it until it snaps into place.

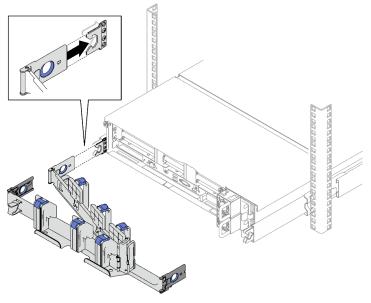


Step 2. Align two outer mounting clips with the outer tabs on the slides; then, push them until they snap into place.

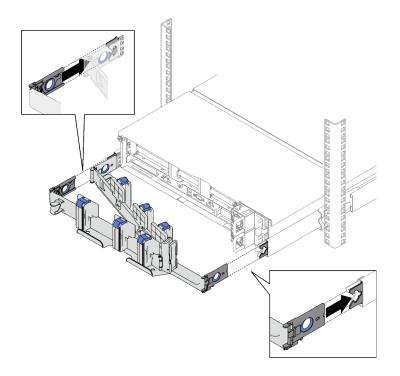


## **Connect and route cables**

**Note:** The following illustrations might differ depending on the server, but the installation method is the same.

Step 1. Attach the power cords and other cables to the rear of the server; then, open the blue retaining clips on the cable baskets to route the cables and power cords in the direction as shown. Properly close them all afterwards.

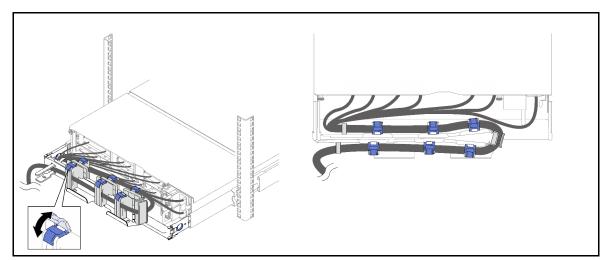


Step 2. Use the cable straps to tightly secure the cables to the front and rear of the CMA.

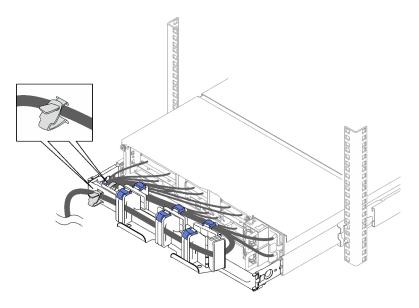

**Attention:** Carefully slide the server back and forward to ensure the cables do not pinch, bind, or hang down into the U space directly below the server.

### **Remove the CMA**

**Note:** The following illustrations might differ depending on the server, but the installation method is the same.

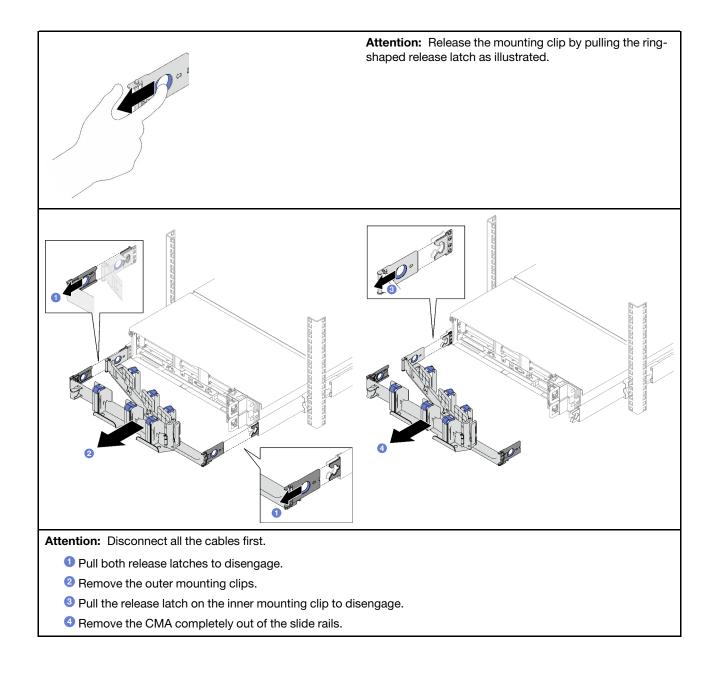

### First Edition (May 2023)

#### © Copyright Lenovo 2023.

LIMITED AND RESTRICTED RIGHTS NOTICE: If data or software is delivered pursuant to a General Services Administration (GSA) contract, use, reproduction, or disclosure is subject to restrictions set forth in Contract No. GS-35F-05925.

Printed in China (1P) P/N: 1PSP47B37782

